

Weightronic

OCS-M1
OCS-M2
便携式电子吊秤
PORTABLE TYPE

产品特点 Characteristic

- ◆ 精密压铸铝机壳
Die-casting aluminum enclosure
- ◆ 字高30mm LED 显示屏 (M1)
30mm LED display (M1)
- ◆ 字高30mm LCD 背光显示屏 (M2)
30mm LCD display with backlight (M2)
- ◆ 不锈钢吊环
Stainless steel shackle
- ◆ 旋转式吊钩
Rotatable hook
- ◆ 大容量充电电池
High capacity rechargeable battery
- ◆ 防水型面板按键
Water-proof panel button
- ◆ 红外遥控器
Infrared remote controlling
- ◆ 多种机壳颜色选择
Various color available
- ◆ 系列规格: 100kg~1000kg
Capacity: 100kg~1000kg




专利号 Patent No.: ZL 2006 3 0110346.3

主要功能 Functions

- 置零
Zero
- 去皮/复皮
Tare In / Tare Out
- 示值保持/解除
Hold
- 欠压警示
Low Voltage Alarm
- 电池电压检测
Battery Supervision
- 超载警示/记录
Overload Alarm / Record
- 任意砝码数字校准
Digital Calibration
- 线性多点修正
3-point Linearity Correction
- 公斤/英镑切换
kg/lb Switch
- 重力加速度设定
Gravity Acceleration Set

相关尺寸和净重 Dimension and Net Weight

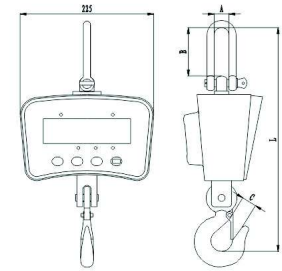

Max. Cap.	A (mm)	B (mm)	C (mm)	L (mm)	N.W. (kg)
100kg	20	80	24	350	5.0
200kg	20	80	24	350	5.0
300kg	20	80	24	350	5.0
500kg	25	85	36	370	5.5
1000kg	25	85	36	370	5.5

▶ 如有改进之处, 仍以实物为准。
Any difference, subject to the actual dimension.

OCS-M1
SERIES: OCS-M2

主要技术指标 Specification

准确度等级 Accuracy Class	OIML III 级
去皮范围 Tare Range	100% F.S.
置零范围 Zero Range	4% F.S.
安全载荷 Safe Overload	120% F.S.
极限载荷 Ultimate Overload	300% F.S.
超载报警值 Overload Alarm	100% F.S. +9e
电池规格 Battery	6V/5Ah
连续使用时间 Battery Life	> 60h
充电器规格 Adaptor	9V/1500mA
遥控器距离 Remote Distance	≥ 10m

增强版功能 Enhanced Functions

- 预置皮重
Tare Set
- 累计/清除/总清
Total/Delete/Clear Total
- 累计值查询
View Total
- 分度值切换
Resolution Switch
- 自动关机时间设定
Auto-off Set
- 空闲省电时间设定
Idle Set
- 显示亮度选择
Display Luminance Set
- 显示速率选择
Display Speed Set
- 抗晃动设置
Anti-Motion Set



可选配件 Optional Accessory



标准配件 Accessory



CE EMC
ISO9001:2000
浙制0000594号
产品标准: GB/T 11883-2002